

# Manhole Inspection Summary

Manhole # S15II1038MH

Printed On: 12/17/2008

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **15II1** Node: **038** Status: **Found**

Insp Date: **6/15/07 10:55 AM**

Incomplete Comments

Crew: **IB, FW**  
Inspector: **Bailey, I**  
Firm: **PER**

**Location** Address: **2400 COLD SRPING LN** Cross Street: **GREENSPRING AVE**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**  
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **THERE IS A CRACK IN WALL OF MH THAT STARTS FROM THE CHIMMEY ALL THE WAY DOWN TO THE BENCH. ALSO CHANNEL IS OFFSET 2' TO RIGHT OF MH**

**Cover** Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)  
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**  
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **3** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **12** (in.)  
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**  
Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**  
Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**  
Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☒ **Mortar** ☐ Roots ☒ **Wall**

**Barrel** Material: **Brick** ☐ Parged  
Shape: **D-Shape** Diameter: **42** (in.) Length: **38** (in.)  
Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**  
Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☒ **Mortar** ☐ Roots ☒ **Wall**

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)  
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:  
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **4** Missing: **0** ☒ **Corroded**

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **1** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S15II1038MH

Printed On: 12/17/2008

Page 2 of 5

Location View



Top View



Corroded steps. Evidence of surcharge - Bench debris.

Defect



Corbel and Barrel deterioration, cracks and infiltration.

Defect



Corbel and Barrel deterioration, cracks and infiltration.

Defect



Deterioration around MH lid.

Defect



Frame leaks. Frame offset. Adjustment deterioration and infiltration. Barrel infiltration.

Defect



Barrel infiltration.


## Manhole Inspection Summary

Manhole # S15II1038MH

Printed On: 12/17/2008

Page 4 of 5

### 10 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

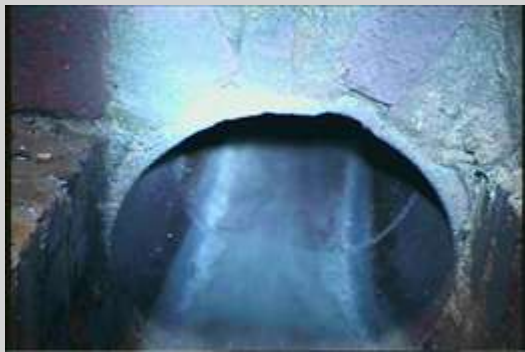

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.39** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ **Grease**

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 6 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.00** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ **Grease**

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S15II1038MH

Printed On: 12/17/2008

Page 5 of 5

10 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **9.24** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ **Grease**

Silt Depth: **0** (in.)

Deposits Extent: **Light**

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection